

**DO NOT DISCARD. DELIVER TO MANUFACTURING
 NO DESECHE. ENTREGA A LA FABRICACION.
 INSTRUCTIONS DE MONTAGE. NE PAS JETER.
 BITTE NICHT WEG WERFEN. BITTE AN DIE PRODUKTION WEITERLEITEN**


*HyperGrip™ Cable Receptacle - UNshielded
 Installation Instructions*



Install Black O-ring (optional)




O-ring installed

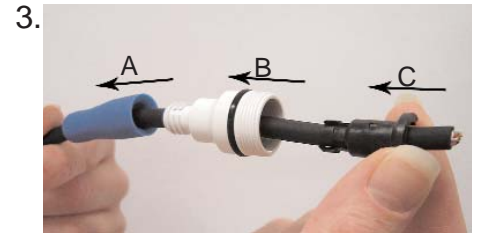


4. Termination Instructions

CRIMP

Strip .118 in. (3mm)

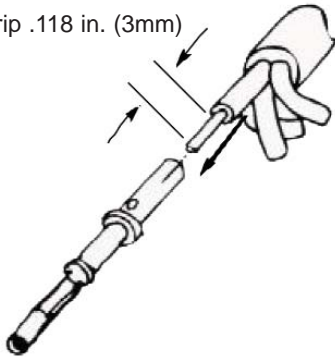

- Strip wire
- Insert into crimp barrell

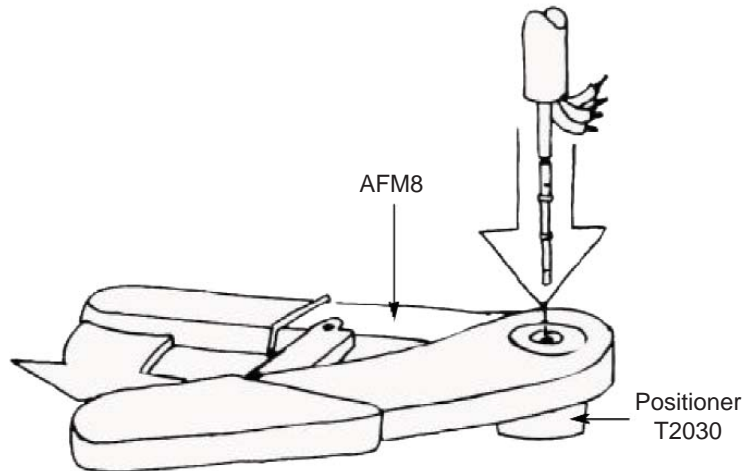


- Insert contact into positioner as shown
- Crimp


OR

SOLDER


Strip .098 IN. (2.5MM)

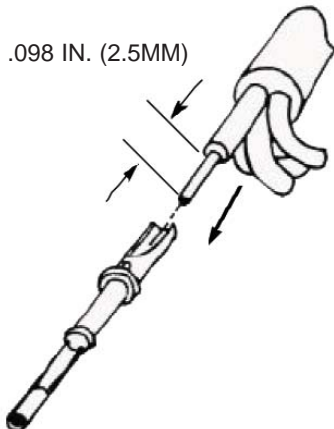


- Strip wire
- Insert into solder cup

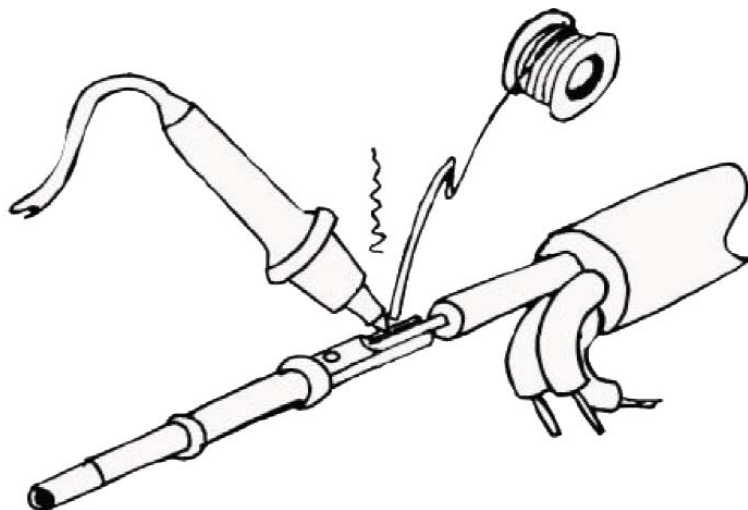


- Solder wire into solder cup

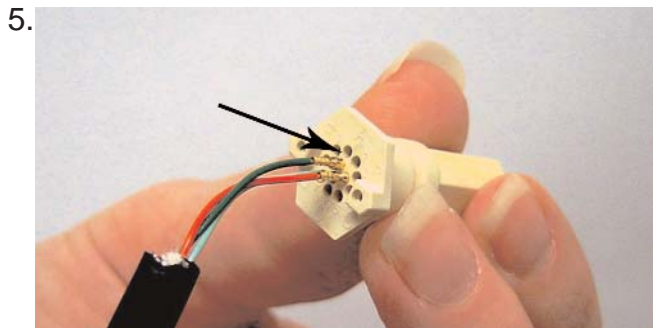


Insert contacts

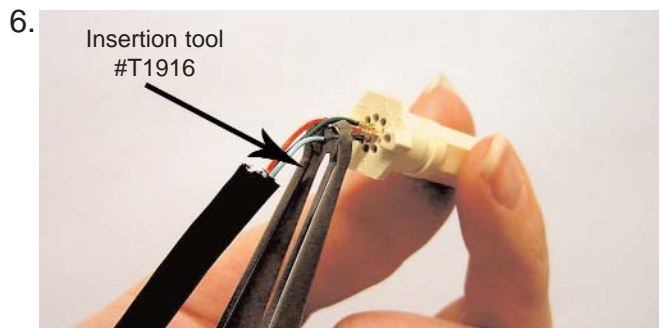

Push in to the stop

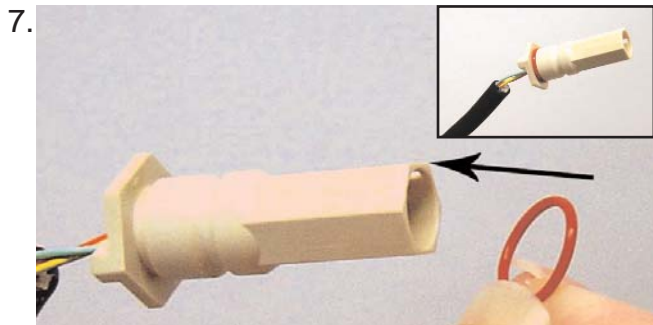

Install Red O-ring

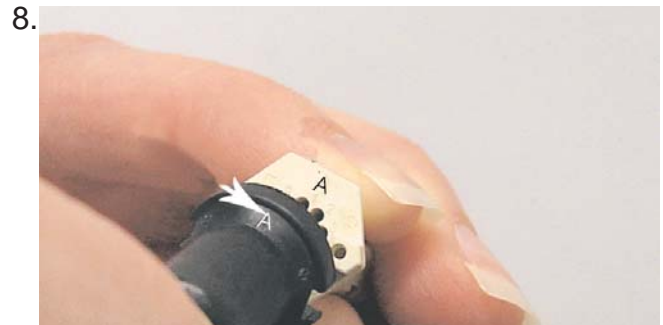

Match "A" to "A" to assemble cable clamp




Assembled cable clamp




Key the connector - choose A, B, C, D, E, or F



Screw in cable receptacle nut

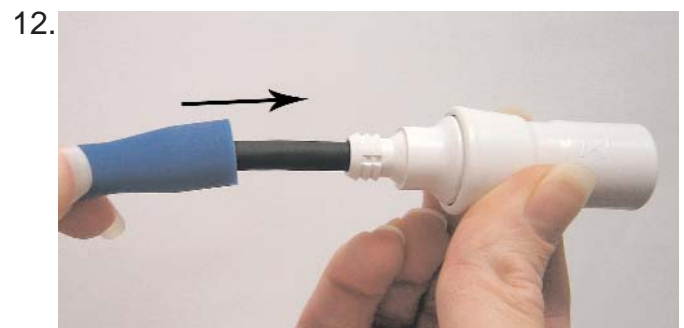

Install strain relief

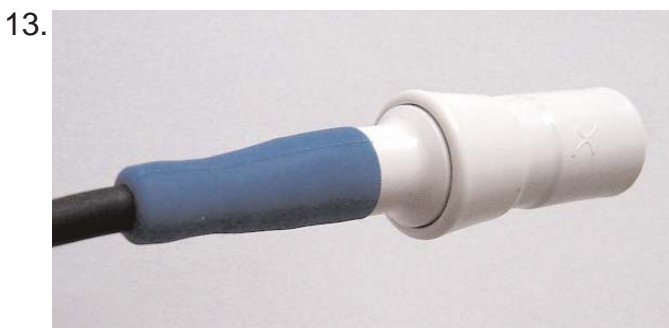

Strain relief installed